

EMP Surge Protector/Filter 4 parts (3L+N) 400/230 V, 1000 A PLP-44011, PLP Series

Excellent protection of 4 lines (3L+N) 400/230V (50/60Hz) for power supply applications in fixed installations up to 1000 A per phase

Protection against HEMP / NEMP- and lightning overvoltages as well as against RF-interferences

Multi-stage protection/filter design providing very high transient energy absorption capability

Thermally monitored Surge Protection Devices with status signalization by potential free contact

Rigid stainless steel construction for direct installation to Faraday cage, approved for 3 bar blast shock according to BZS /BABS - Standard



Meteolabor PLP-Series EMP Protector/Filter consist of Combinations of coarse and fine protection stages in combination with filtering components. This guarantees optimized protection of mission critical equipment against very fast transient overvoltages (e.g. NEMP / HEMP).

The PLP-Series is threat-level tested against EMP according to MIL-STD-188-125-1, short pulse and intermediate pulse.

Extremely high surge currents up to 100 kA (8/20µs) per line can be diverted.

For safety a capacitor discharge resistor is built in.

Applications

Meteolabor EMP-Protector/Filters protect sensitive electronics such as Computers, telecommunication equipment, controls etc. from damages due to NEMP / HEMP or lightning effects.

Radio frequency interferences are filtered by high quality low-pass filters. The filter is designed for fixed installation with permanent grounding.

Applications range from fixed military facilities (e.g. C⁴I facilities) to civilian or industrial projects requiring high reliability.

Technical Data PLP-44011

Nominal voltage U_N	3x400/230 V AC	50/60 Hz
Max. operating voltage U_C	3x460/255 V AC	50/60 Hz
Nominal current I_N	1000 A	Effective at T_{amb} 40 °C
Max. surge current I_{Max}	100 kA	Each L/N → PE, shape 8/20 µs, T_{amb} 40°C, at least 1 pulse
Max. lightning impulse current I_{Imp}	20 kA	Each L/N → PE, shape 10/350 µs, T_{amb} 40°C, at least 1 pulse
DC resistance	< 0.3 mΩ	Each path L/N
Residual voltage HEMP-condition	< 50 V	L/N → PE, short pulse according MIL-STD-188-125-1
Residual voltage surge	< 1 kV	L/N → PE, pulse 4 kV / 2 kA according to IEC 61000-4-5
Attenuation	> 80 dB	200 kHz – 1 GHz, 50 Ω - System
50 Hz AC-leakage current	< 3.5 A	L → PE at U_N , 50 Hz
Combination Surge Protection Device	SPD Type 1 + 2	Fault indication by opening of a potential-free contact
Potential free contact of SPD	Normally closed	Max. 250 V AC, 0.5 A, open if at least one SPD has disconnected
Case material	Steel V2A	Central cover is made from aluminum
Dimensions	1360x670x129 mm	External dimensions, Details see drawing
Weight	Approx. 492 kg	Total weight (4 boxes, each 123 kg)
Approval Number BZS	LS S07-911	Shock (3 bar) according BABS / BZS

— CLICK HERE —

REQUEST QUOTE

www.geminelec.com


PAGE 1 OF 2 PAGES

(800) 882-6414 | sales@geminelec.com



Dimensions (Single case of four cases)

Note: The 1000A EMP-Protection consists of 4 identical cases (one for each phase / neutral)

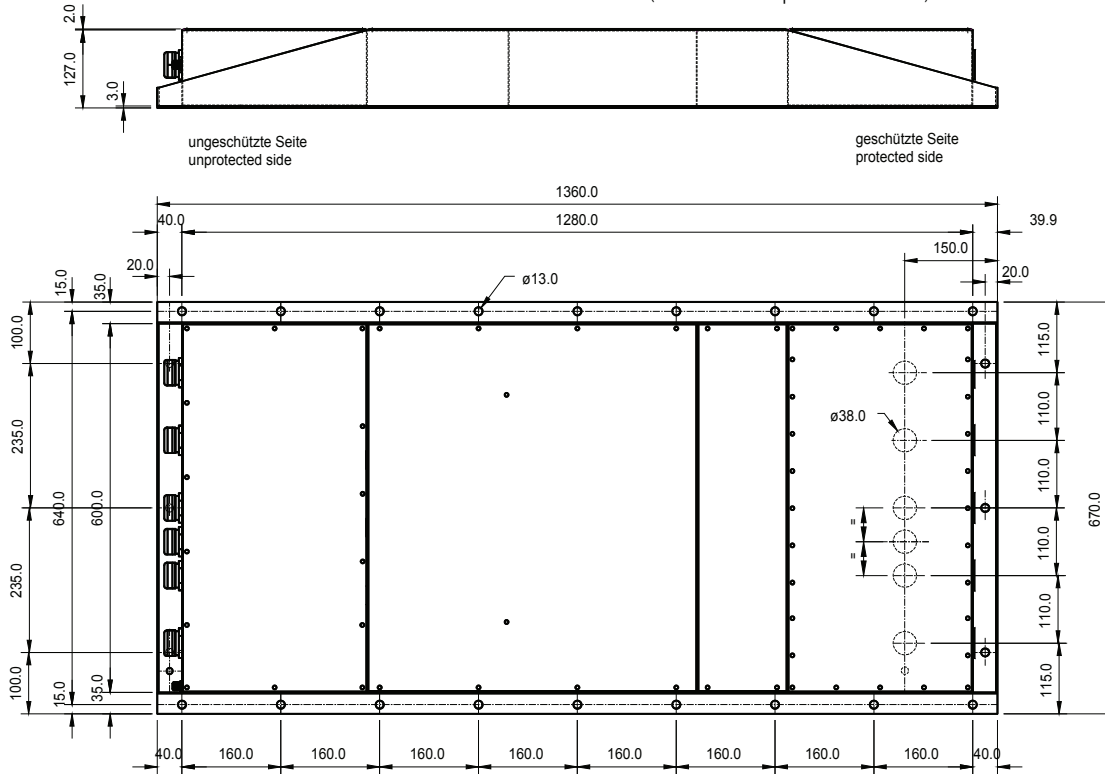

Installation Notes

- The EMP protector/filter has to be installed by electrically skilled personnel.
- The electrical wiring has to be done according to local regulations.
- The max. values stated in this datasheet must not be exceeded under any circumstances.
- PLP-series EMP protector/filter shall be permanently (not pluggable) connected to the grid.
- Residual current circuit breakers shall be used on the protected side of the surge protector, where they are protected from transient overvoltages.
- The EMP protector/filter may be directly installed to a Faraday cage as feed-through device. Otherwise the cabling on the protected side must be shielded.
- Do not use spacers between filter and Faraday cage.
- The screws of the covers shall be slightly lubricated for best performance.


Installation Instruction for mechanical shock protection

- The PLP-Series is approved for 3 bar shock protection according to Swiss Federal Office for Civil Protection (BABS, formerly BZS).
- Installation can be done by screws or direct welding to the Faraday cage. Usually installation using screws or bolts is more convenient.
- If screwed at least 10 pieces equally spaced screws M12 of class 8.8 including washer and spring washer shall be used. The torque shall be 83 Nm. Using more screws improves the electrical contact with the Faraday cage.
- Installation to a concrete wall requires at least 10 dowels approved by BABS. Each dowel shall have at least the capability to hold 4.3 kN.
- If welded at least 10 equally spaced fillet welds having a length of 50 mm shall be applied.

Ordering Information

Part.-Nr: **PLP-44011**
 Type-Nr.: USS-3x400/230V/1000A/EMP-M

— [CLICK HERE](#) —

Warning
 High AC earth leakage current! Case of filter (Protective earth) must be solidly and permanently earthed. Always install protective earth first.